

Unique Id: 009DF37D-1645AEA0-1C02A1

(c) Copyright 1999 Compaq Computer Corporation. All rights reserved

SOURCE: Compaq Computer Corporation INFORMATION BLITZ

INFORMATION BLITZ TITLE:

New Console Firmware for AlphaServer ES40

DATE: 6-October-1999

INFORMATION BLITZ #: TD 2703-CR

AUTHOR: Michael Renda

TEL#: 508-467-8854

EMAIL: michael.renda@compaq.com

DEPARTMENT: High Performance Server Division

=====

PRODUCT NAME(S) IMPACTED: AlphaServer ES40

PROBLEM STATEMENT:

- 1) EV6 CPU Version 2.5 requires console firmware V5.5-107 (or greater).
- 2) PALcode change for system hangs caused by simple lock timeouts.
- 3) Remote Mgmt Console (RMC) code change for mistake reading CPU eeprom data.

PROBLEM SYMPTOM:

- 1) EV6 CPU V2.5 CPU ID is not recognized in Hardware Restart Parameter Block.
- 2) There have been a number of reports of systems running Tru64 UNIX experiencing CPU hangs that result in "simple lock timeout" or "tb_shoot ack timeout" panics, and some system hangs. The reason for the panics is a hung secondary CPU, and the reason for the system hang is a hung primary CPU.
- 3) The failure occurs when CPU3 is installed, but CPU1 is not installed. The RMC will complain with "Bad CPU EEPROM Data" because it mistakenly looks at the CPU1 area for CPU3 data.

SOLUTION:

Update the console firmware to V5.5-107. Console firmware is available at <http://ftp.digital.com/pub/Digital/Alpha/firmware/interim/es40/>.

Instructions for the update may be found at:

<http://ftp.digital.com/pub/Digital/Alpha/firmware/interim/es40/readme.txt>.

ADDITIONAL INFORMATION:

Additional information may be found in Blitz TD 2706-CR entitled:

[TD 2706-CR] AlphaServer ES40 Firmware Update Procedure - BLITZ

```
*****< NOTE >*****
*
* INFORMATION IN THIS DOCUMENT REPRESENTS OPERATIONAL EXPERIENCES AND
* SUGGESTIONS BY COMPAQ OR PARTNER EMPLOYEES. COMPAQ SHALL NOT BE
* RESPONSIBLE FOR ANY ERRORS OR OMISSIONS CONTAINED IN THIS DOCUMENT,
* AND RESERVES THE RIGHT TO MAKE CHANGES TO IT WITHOUT NOTICE.
*
*****
```

```
<>UPDATE /TEXT_UPDATE/UNIQUE_IDENTIFIER="009DF37D-1645AEA0-1C02A1"-
/TITLE="[TD 2703-CR] New Console Firmware for AlphaServer ES40 - BLITZ"-
/BADGE=(AUTHOR="999997",ENTER="120172",MODIFY="120172",-
EDITORIAL_REVIEW="120172",TECHNICAL_REVIEW="999997")-
/NAME=(AUTHOR="MICHAEL RENDA",ENTER="CATHY MARTIN",-
MODIFY="CATHY MARTIN",EDITORIAL_REVIEW="CATHY MARTIN",TECHNICAL_REVIEW="MICHAEL REND
/DATE=(AUTHOR=" 6-OCT-1999",ENTER=" 6-OCT-1999",-
EXPIRE=" 6-OCT-2001",FLASH=" 6-OCT-1999",MODIFY="14-OCT-1999",-
EDITORIAL_REVIEW=" 6-OCT-1999",TECHNICAL_REVIEW=" 6-OCT-1999")-
/GEOGRAPHY="USA"/SITE="EIRS"/OWNER="TIM-BLITZ"-
/FLAGS=(USA_CUSTOMER_READABLE,NOPOST_MESSAGE_DISPLAY,NOLOCAL,-
EUR_CUSTOMER_READABLE,GIA_CUSTOMER_READABLE,NOINIT_MESSAGE_DISPLAY,-
EDITORIAL_REVIEWED,FIELD_READABLE,FLASH,TECHNICAL_REVIEWED,READY)
```